

DataVS2-xx-DE-AOR/OBJ-x

QUICK REFERENCE GUIDE

MINIMUM SYSTEM REQUIREMENTS

Check that your Personal Computer meets the following minimum requirements for system interfacing:

- Pentium 1,7 GHz processor
- 1 GB of RAM
- Monitor SVGA (1024x768 pixel)
- Network Connection board 10/100 Mbps
- 50 MB Hard Disk drive free space

For best performances the following requirements are recommended:

- Pentium 2 GHz processor
- 2 GB of RAM
- Monitor resolution 1280x768 at least
- Network Connection board 100 Mbps
- 60 MB Hard Disk drive free space

DESCRIPTION

The DataVS2 series of vision sensors offers the easiest way to solve the most common machine vision applications



- -Compact IP50 housing
- -Integrated light LED illuminator
- -Selectable lens
- -Focus ring
- -Standard M12 connectors
- -Teach button
- -Image sensor 640x480 pixel

ELECTRIC CONNECTIONS

M12 4 poles Ethernet: (connectivity) pin 1: White/Orange: Rx+ pin 2: White/Green: Tx+ pin 3: Orange: Rxpin 4: Green: Tx-M12 8 poles: (power and I/O)


pin 1: white: Inspection Selection Input pin 2: brown : 24 VDC

pin 3: green : Output 4 / Ext. Illuminator

pin 4: yellow: Output 1

pin 5: grey : Output 2 pin 6: pink: Output 3

pin 7: blue: Ground pin 8: red : External Trigger

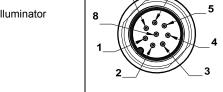

INDICATORS

- 1. Power, green;
- Output 1, orange;
- 3. Output 2, orange;
- 4. Network connection, green.



CONFIGURATION

Easy Graphic User Interface – Starting Configuration

DataVS2 sensor requires a preliminary setting: this is made in 3 steps by using the Easy GUI interface.



After the start-up of the program, the user is asked to establish a connection to the sensor:



Find sensor: research of the sensors connected to the network

Connect to: connection to the last sensor you have worked with

Offline: open a working session without If the sensor found is displayed in red, select Configure and follow

Step 1: Image Setup

The first step allows to handle the connection to the sensor and set the parameters related to the image quality. Once achieved the desired result, the image can be saved and set as reference for the sensor operations

the instructions

- Online/Offline selection



- Select a Task: create a new inspection or open an existing inspection from the PC or from the
- Set Reference Image: save the image as reference for the following steps

Step 2: Teach

In this step you may configure the desired control.




- -Select Locator: a locator is a special Tool allowing the sensor to find the object inside the image. Once the control is chosen it is added to current inspection. It is possible to add at most one locator to current inspection
- Select Control: It allows selecting the controls that will be added to the inspection process. Once the control is chosen it is added to current inspection. It is possible to add more than one control to current inspection.
- Output Setup: configuration of the 4 digital outputs.

After selecting the control, it's necessary to position it on the reference image. by clicking in the working area and by moving and resizing the ROI.

The Control Panel displays the control's parameters, initialized to standard values: it is possible to modify them by using the sliders or by directly writing new numeric values.

The STATUS indicator, as well as the ROI contour reveals the result of control application by assuming red (bad result) or green (good result) colouring.

Step 3: Run

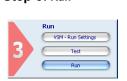

- VSM \ Run Settings: configure VSM options and running options for the current Inspection...
- Test: verification on the PC (Online o Offline) of the selected controls
- Run: store and launch the inspection on the

CONTROL PANEL

Control	Functioning	Applications		
	Searches for a pattern inside	Verifies logo on food		
Pattern Match	the target area	packages		
Contour Match	Shape control	Verifies the integrity of mechanical parts contours		
Position	Identifies the object position edge (edge detection)	Controls the level of liquids in bottles		
Width	Measures the distance between two points	Assembling control		
Edge Count	Identifies all edges along an axis	Counts the blisters in stack for pharmaceutical		
Contrast	Calculates the contrast in an image	Verifies overprint of labels		
Brightness	Calculates the brightness of an image	cap and nozzle on phials		
Geometric Pattern Match	Searches for a pattern inside the target area. It able to detect the position and the orientation of a target	orientation on assembly		

COMMUNICATIONS


Communication with the sensor occurs via the Ethernet network

Direct connection: personal computer is connected directly to device using a "cross cable"



Warning: in case of direct connection the PC requires a fixed IP address


Through LAN: use common network (non-cross) cables normally used to connect devices to routing hubs.

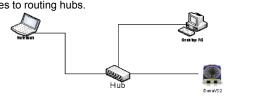

The sensor has the following default IP address: IP Address: 172.27.101.208 Subnet mask: 255.255.0.0

HARDWARE CONNECTIONS

M12 8 Poles (Power and I/O)

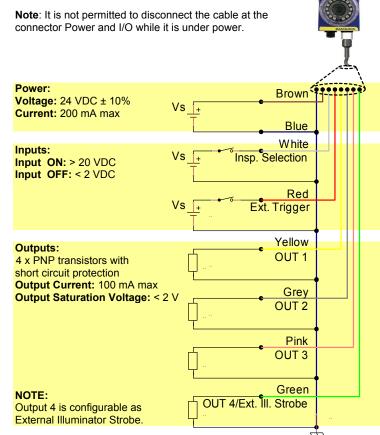


OPERATING DISTANCE

Operating distance(mm):	DataVS2-06- DE-XXX-X	DataVS2-08- DE-XXX-X	DataVS2-12- DE-XXX-X	DataVS2-16- DE-XXX	DataVS2-16- DE-XXX-I
50	39 x 29	24 x 18	16 x 12	-	-
80	58 x 44	38 x 29	26 x 19	-	-
110	78 x 58	53 x 40	35 x 26	-	-
140	99 x 73	67 x 50	45 x 34	-	-
170	119 x 88	82 x 61	54 x 41	-	-
200	138 x 104	196 x 72	64 x 48	48 x 36	-
300	207 x 155	144 x 108	96 x 72	72 x 54	72 x 54
400	274 x 206	192 x 144	128 x 96	96 x 72	96 x 72
500	338 x 254	240 x 180	160 x 120	120 x 90	120 x 90
600	405 x 304	288 x 216	192 x 144	144 x 108	144 x 108

TECHNICAL DATA

Supply voltage (Vs):	24 Vdc ± 10%			
Ripple voltage:	1 Vpp max with illuminator			
. apple velage.	2 Vpp max without illuminator			
Current draw with illuminator: (depends on how long illuminator stays on)	max 200 mA at 24 VDC			
Outputs:	4 PNP outputs (short circuit protection) (Output 4 is configurable as External Illuminator Strobe)			
Output current:	100 mA max			
Output saturation voltage:	< 2 V			
Network interface:	M12 4 poles – 10/100 Mbps Ethernet			
Optics:	Integrated			
Resolution:	640 × 480 (VGA)			
Dimensions:	69.8 × 51.5 × 40 mm			
Indicators:	4 LED			
Setup:	1 Teach-In button			
Data retention:	Non-volatile FLASH memory			
Operating temperature:	-10 °C +55 °C			
Storage temperature:	-25 °C +75 °C			
Vibrations:	14 mm @ 2 to 10 Hz;			
(EN60068-2-6)	1.5 mm @ 13 to 55 Hz;			
	2 g @ 70 to 200 Hz; 2 hours on each axis			
Shock resistance: (EN60068-2-27)	11 ms (30 G) 6 shock for every axis			
Housing material:	Aluminium alloy / ABS			
Mechanical protection:	IP50			
Connections:	M12 8 pole A-code, M12 4 pole D-code			
Weight:	125 g			

MECHANICAL DIMENSIONS

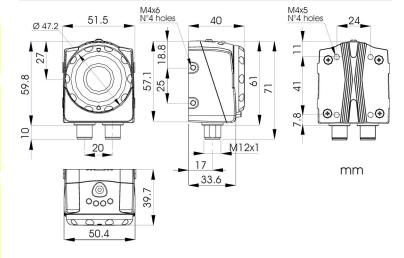

Datalogic S.r.l. Via S. Vitalino 13 - 40012 Calderara di Reno - Italy Tel: +39 051 3147011 - Fax: +39 051 3147205 - www.datalogic.com

Helpful links at www.datalogic.com: Contact Us. Terms and Conditions, Support

The warranty period for this product is 36 months. See General Terms and Conditions of Sales for



© 2011 - 2017 Datalogic S.p.A. and/or its affiliates • ALL RIGHTS RESERVED. • Without limiting the rights under copyright, no part of this documentation may be reproduced, stored in or introduced into a retrieval system, or transmitted in any form or by any means, or for any purpose, without the express written permission of Datalogic S.p.A. and/or its affiliates. Datalogic and the Datalogic logo are registered trademarks of Datalogic S.p.A. in many countries, including the U.S.A. and the E.U. All other trademarks and brands are property of their respective owners. Datalogic reserves the right to make modifications

830000037 (Rev. I)